

Ship Name: **BOX HAMBURG**
IMO Number: **9190810**
Date Detained: **04/03/2003**
Port: **Jacksonville, Florida**

Ship Type: **Containership**
Flag: **Malta**
Class Society: **Bureau Veritas**
Company(s): Owners, Operators or Managers
Furtrans Denizcilik VE SAN A.S.
Ileyac Shipping Ltd

Deficiencies: Code - Category
1020 - Fire alarm

0610 - Lifeboats

Description
Fire alarm and general alarm system inoperative.

Improper arrangement of lifeboat starting batteries. Unable to start since batteries were dead.

Ship Name: **CARIBBEAN DOLPHIN**
IMO Number: **7200271**
Date Detained: **04/03/2003**
Port: **Miami, Florida**

Ship Type: **General Dry Cargo Ship**
Flag: **Cambodia**
Class Society: **International Register of Shipping**
Company(s): Owners, Operators or Managers
Pioneer Sun Limited
Hispanic Shipping Line Corp.

Deficiencies: Code - Category
0984 - Hull - cracking

0984 - Hull - cracking

0987 - Bulkheads - cracking

1299 - Other (Load Lines)

Description
Vessel has small hole in the hull located in the forward port cargo hold requiring a plug and shoring.

Severe wastage on deck with unauthorized and substandard insert.

Large crack, allowing free-flow of water, into watertight bulkhead between forward port and middle port cargo holds. Crack formed due to severe wastage.

Permanent loadline markings on port and starboard sides are wasted and falling off of vessel. Permanent markings were hollow and tack welded allowing seawater to corrode

Ship Name: **FEDERAL PESCADORES**
IMO Number: **8501036**
Date Detained: **04/07/2003**
Port: **Miami, Florida**

Ship Type: **General Dry Cargo Ship**
Flag: **Panama**
Class Society: **Bureau Veritas**
Company(s): Owners, Operators or Managers
Moon Bright Shipping
Shih Wei Navigation Co.
Moon Bright Shipping Corp

Deficiencies: Code - Category
0730 - Appliances (general equipment)

Description
Holes in fire main piping starboard side mid-ship. Observed water spraying from fire main piping when system was energized.

Ship Name: **MARTINIKA**

IMO Number: **7637450**

Date Detained: **04/24/2003**

Port: **Tampa, Florida**

Ship Type: **General Dry Cargo Ship**

Flag: **Saint Vincent and the Grenadines**

Class Society: **International Registry of Shipping**

Company(s): Owners, Operators or Managers
Sun Marine Lines, S.A.

Deficiencies: Code - Category
1299 - Other (Load Lines)

0988 - Deck - corrosion

0710 - Fire prevention

Description

Severe wastage and loss of integrity to transverse side shell framing and under deck transverse framing in way of main cargo hold.

Severe wastage of forecastle deck in way of foundations of deck machinery.

Improper use of flammable bulkhead in way of paint locker and battery storage areas.

Ship Name: **NEAMONI**
IMO Number: **7110921**
Date Detained: **04/03/2003**
Port: **Savannah, Georgia**

Ship Type: **General Dry Cargo Ship**
Flag: **Panama**
Class Society: **Polski Rejestr Statkow**
Company(s): Owners, Operators or Managers
Neaamoni Transpor tInc.
Overseas Shipping Co. Ltd

Deficiencies: Code - Category
1499 - Other (Prop. & Aux. Machinery)

2510 - Safety and environmental policy

2550 - Maintenance of ship and equipment

2510 - Safety and environmental policy

Description
Crack on the crankcase of the #1 SSDG. Port side cracks are located in an existing polymer resin patch. Fuel oil leak on fuel return lines.

Vessel master failed to implement company SMS. As per SMS, captain was not notified of deficiencies which resulted in not notifying the company's designated person.

Objective evidence discovered in expanded ISM exam revealed a failure of the Safety Management System. Vessel to conduct full external ISM audit to the satisfaction of the flag Administration.

=====

Ship Name:**PAULINE** Ship Type:

General Dry Cargo Ship

IMO Number: **7413919**
Date Detained: **04/15/2003**
Port: **Miami, Florida**

Flag: **Panama**
Class Society: **International Register of Shipping**
Company(s): Owners, Operators or Managers
Luxury Marine Lines, Inc

Deficiencies: Code - Category
0730 - Appliances (general equipment)
1699 - Other (radio)
0699 - Other (Life Saving Appliances)
0950 - Electric equipment in

0945 - Emergency lighting, etc

0955 - Pilot ladders
0499 - Other (Food And Catering)
1499 - Other (Prop. & Aux. Machinery)

Description
Missing fixed fire fighting system in engine

Vessel has no GMDSS system.
Hydrostatic releases on both liferafts are expired.

Numerous dead-ended wires throughout the vessel.

Generator currently damages all electrical systems while in operation.

Repair pilot ladder.

Galley and staterooms infested with insects.

Improper fuel oil hose on boiler in way of fuel oil filter.

Ship Name: **REDUTA ORDONA**
IMO Number: **7515004**
Date Detained: **04/21/2003**
Port: **N. Charleston, South Carolina**

Ship Type: **Bulk Carrier**
Flag: **Malta**
Class Society: **Polski Rejestr Statkow**
Company(s): Owners, Operators or Managers
Polska Zegluga Morska
Cepheus Shipping Ltd.

Deficiencies: Code - Category
1730 - Oily-water separating equipment
1730 - Oily-water separating equipment
2550 - Maintenance of ship and equipment

Description
Inoperable oily water separator.

All oily water filters in poor condition. No preventative services being conducted on Vessel's Chief Engineer unable to provide sufficient proof that maintenance of oily water separator is being done.

=====

Ship Name: **SACURA**
IMO Number: **8005551**
Date Detained: **04/16/2003**
Port: **Hampton Roads, Virginia**

Ship Type: **General Dry Cargo Ship**
Flag: **Liberia**
Class Society: **Russian Maritime Register of Shipping**
Company(s): Owners, Operators or Managers
Solin Shipping Co
Intresco Ltd

Deficiencies: Code - Category
0936 - Steering gear

1499 - Other (Prop. & Aux. Machinery)

2510 - Safety and environmental policy

2550 - Maintenance of ship and equipment

2550 - Maintenance of ship and equipment

2545 - Reports/analysis of non-conformities, etc.

2545 - Reports/analysis of non-conformities, etc.

2555 - Documentation

Description
Excessive rudder bearing clearance noted during test of steering gear.

Cement patches in engine room on the following piping systems; auxiliary salt-water overboard portside engine room; salt -water piping connection at #1 pump; Sewage system overboard portside engine room

Objective evidence discovered during expanded ISM examination revealed a failure in the Safety Management System for the deficiencies listed. External audit ordered.

No documentation could be provided identifying rudder stock movement on required test and inspection.

No documentation could be provided reporting temporary cement patch repairs to company Technical Department or Class

The vessel has raised no damage reports nor non-conformities in the entire time the Safety Management System has been onboard.

Cement patches installed prior to Master and Chief Engineer joining vessel in September 2002. Company technical inspections and internal audit failed to identify deficiencies as well as annual class survey done in February 2003.

A computer disk was provided to the vessel 2 months prior, of new checklists and forms.

No record of that change could be provided.
No register of forms is available onboard to
validated the most current issue of forms and
checklists.

=====

| | | | |
|----------------|-----------------------------|----------------|---|
| Ship Name: | SORAKSAN | Ship Type: | Refrigerated Cargo Carrier |
| IMO Number: | 8723361 | Flag: | Panama |
| Date Detained: | 04/18/2003 | Class Society: | Bureau Veritas |
| Port: | Dutch Harbor, Alaska | Company(s): | <u>Owners, Operators or Managers</u> Neutrino S.A. Eastwind |

| | | |
|---------------|-------------------------------|---|
| Deficiencies: | <u>Code - Category</u> | <u>Description</u> |
| | 0710 - Fire prevention | Pantry passageway doors to mess room do not meet the requirements of the B-Class division bulkheads in which they are installed. |
| | 0710 - Fire prevention | Mess room doors (wooden) leading to passageway do not meet the requirements of the B-Class Division in which they are |